


AMERICAN & OHIO LOCOMOTIVE CRANE CO. INC.

811 Hopley Avenue P.O. Box 511 Bucyrus, Ohio 44820

800-993-6446 ~ 419-562-6010 ~ Fax: 419-562-2565 ~ www.aolcrane.com

OEM Product Support Bulletin No. 39

DATE:	September 17, 2013 (revision date)	
SUBJECT:	BOOM HOIST BRAKE LEVER PIN UPGRADE KIT Kit Part No. <u>410349</u>	
RATING:	DIRECTIVE (Action is required)	ALERT (Safety Issue)
		PRODUCT IMPROVEMENT (Enhanced Product)
Machine Model (s):	All Ohio DE Series Locomotive Cranes	
Serial Numbers:	All DE Series	
Summary:	This updated Kit eliminates the Boom Hoist Brake Band Pin from locking up.	
Operational Impact:		
	• Kit replaces the existing lubricating bearing.	pins with a stainless steel pin and a self-
	Ease of movement for the brake lever.	
	• Greater reliability for the boom hoist brake.	
	Helps eliminate Boom Ho	ist Brake Band Fatigue.

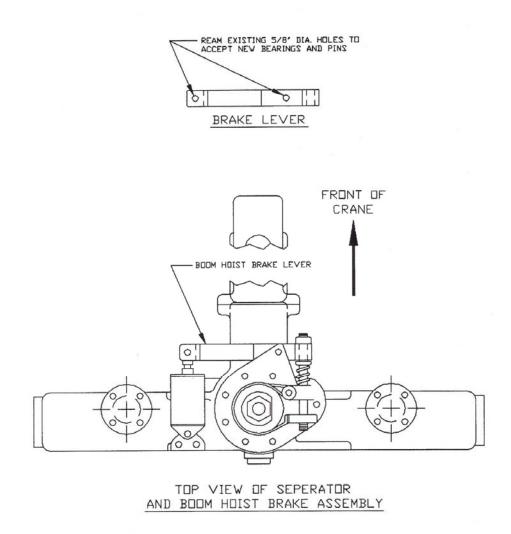

Boom Hoist Brake Band Assembly should be periodically inspected for wear and cracking.

Brake Band should be release completely while booming up and down.